



[4910-13-P]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-0932; Directorate Identifier 2014-NM-205-AD; Amendment 39-18326; AD 2015-23-10]

RIN 2120-AA64

Airworthiness Directives; The Boeing Company Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Final rule.

SUMMARY: We are adopting a new airworthiness directive (AD) for certain The Boeing Company Model 747-8 series airplanes. This AD was prompted by a report of improperly installed outboard stowage bin modules in the passenger compartment found during maintenance. Further investigation revealed that certain attachment bracket bushings were missing or had moved out of the holes. This AD requires installing a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment. We are issuing this AD to prevent detachment of the quick-release pin, which could result in separation of the lateral support tie rod and subsequent detachment of the module and consequent injuries to passengers or flightcrew.

DATES: This AD is effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

The Director of the Federal Register approved the incorporation by reference of a certain publication listed in this AD as of [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221. It is also available on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0932.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-0932; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this AD, the regulatory evaluation, any comments received, and other information. The address for the Docket Office (phone: 800-647-5527) is Docket Management Facility, U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE., Washington, DC 20590.

FOR FURTHER INFORMATION CONTACT: Stanley Chen, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6585; fax: 425-917-6590; email: stanley.chen@faa.gov.

SUPPLEMENTARY INFORMATION:

Discussion

We issued a notice of proposed rulemaking (NPRM) to amend 14 CFR part 39 by adding an AD that would apply to certain The Boeing Company Model 747-8 airplanes. The NPRM published in the Federal Register on April 29, 2015 (80 FR 23739). The

NPRM was prompted by a report of improperly installed outboard stowage bin modules in the passenger compartment found during maintenance. Further investigation revealed that certain attachment bracket bushings were missing or had moved out of the holes. The NPRM proposed to require installing a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment. We are issuing this AD to prevent detachment of the quick-release pin, which could result in separation of the lateral support tie rod and subsequent detachment of the module and consequent injuries to passengers or flightcrew.

Comment

We gave the public the opportunity to participate in developing this AD. The following presents the comment received on the NPRM (80 FR 23739, April 29, 2015) and the FAA's response to each comment.

Request to Revise Costs of Compliance Section

Boeing asked that we add the parts cost to the cost table in the NPRM (80 FR 23739, April 29, 2015). Boeing stated that the parts cost per spacer is \$80, which increases the cost per product to \$1,100, and the cost on U.S. operators to up to \$2,200.

We agree with the commenter for the reason provided. We have included the parts cost and changed the amount of the cost per product and the cost on U.S. operators specified in the "Costs of Compliance" section of this final rule.

Conclusion

We reviewed the relevant data, considered the comment received, and determined that air safety and the public interest require adopting this AD with the changes described previously and minor editorial changes. We have determined that these minor changes:

- Are consistent with the intent that was proposed in the NPRM (80 FR 23739, April 29, 2015) for correcting the unsafe condition; and

- Do not add any additional burden upon the public than was already proposed in the NPRM (80 FR 23739, April 29, 2015).

Related Service Information under 1 CFR part 51

We reviewed Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014. The service information describes procedures for installing a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of this AD.

Costs of Compliance

We estimate that this AD affects 2 airplanes of U.S. registry.

We estimate the following costs to comply with this AD:

Estimated costs

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Spacer installations	Up to 12 work-hours X \$85 per hour = Up to \$1,020	\$80 per spacer	Up to \$1,100	Up to \$2,200

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: “General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by

prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

This AD will not have federalism implications under Executive Order 13132. This AD will not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify that this AD:

- (1) Is not a “significant regulatory action” under Executive Order 12866,
- (2) Is not a “significant rule” under DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979),
- (3) Will not affect intrastate aviation in Alaska, and
- (4) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

Adoption of the Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA amends 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

2015-23-10 The Boeing Company: Amendment 39-18326 ; Docket No. FAA-2015-0932; Directorate Identifier 2014-NM-205-AD.

(a) Effective Date

This AD is effective [INSERT DATE 35 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

None.

(c) Applicability

This AD applies to The Boeing Company Model 747-8 series airplanes, certificated in any category, as identified in Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014.

(d) Subject

Air Transport Association (ATA) of America Code 25, Equipment/Furnishings.

(e) Unsafe Condition

This AD was prompted by a report of improperly installed outboard stowage bin modules in the passenger compartment found during maintenance. Further investigation revealed that certain attachment bracket bushings were missing or had moved out of the holes. We are issuing this AD to prevent detachment of the quick-release pin, which could result in separation of the lateral support tie rod and subsequent detachment of the module and consequent injuries to passengers or flightcrew.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Installation

Within 36 months after the effective date of this AD: Install a spacer on the end of each quick-release pin that attaches the outboard stowage bin module to the lateral support tie rods of the main deck passenger compartment, in accordance with the Accomplishment Instructions of Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014.

(h) Alternative Methods of Compliance (AMOCs)

(1) The Manager, Seattle Aircraft Certification Office (ACO), FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the manager of the Seattle ACO, send it to the attention of the person identified in paragraph (i) of this AD. Information may be emailed to: 9-ANM-Seattle-ACO-AMOC-Requests@faa.gov.

(2) Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office.

(3) For service information that contains steps that are labeled as Required for Compliance (RC), the provisions of paragraphs (h)(3)(i) and (h)(3)(ii) apply.

(i) The steps labeled as RC, including substeps under an RC step and any figures identified in an RC step, must be done to comply with the AD. An AMOC is required for any deviations to RC steps, including substeps and identified figures.

(ii) Steps not labeled as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the RC steps, including substeps and identified figures, can still be done as specified, and the airplane can be put back in an airworthy condition

(i) Related Information

For more information about this AD, contact Stanley Chen, Aerospace Engineer, Cabin Safety and Environmental Systems Branch, ANM-150S, FAA, Seattle Aircraft Certification Office, 1601 Lind Avenue SW., Renton, WA 98057-3356; phone: 425-917-6585; fax: 425-917-6590; email: stanley.chen@faa.gov.

(j) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference (IBR) of the service information listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this service information as applicable to do the actions required by this AD, unless the AD specifies otherwise.

(i) Boeing Special Attention Service Bulletin 747-25-3649, dated July 24, 2014.

(ii) Reserved.

(3) For service information identified in this AD, contact Boeing Commercial Airplanes, Attention: Data & Services Management, P. O. Box 3707, MC 2H-65, Seattle, WA 98124-2207; telephone 206-544-5000, extension 1; fax 206-766-5680; Internet <https://www.myboeingfleet.com>.

(4) You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

(5) You may view this service information that is incorporated by reference at the National Archives and Records Administration (NARA). For information on the

availability of this material at NARA, call 202-741-6030, or go to:
<http://www.archives.gov/federal-register/cfr/ibr-locations.html>.

Issued in Renton, Washington, on November 4, 2015.

Dionne Palermo,

Acting Manager,

Transport Airplane Directorate,

Aircraft Certification Service.

[FR Doc. 2015-28897 Filed: 11/19/2015 8:45 am; Publication Date: 11/20/2015]